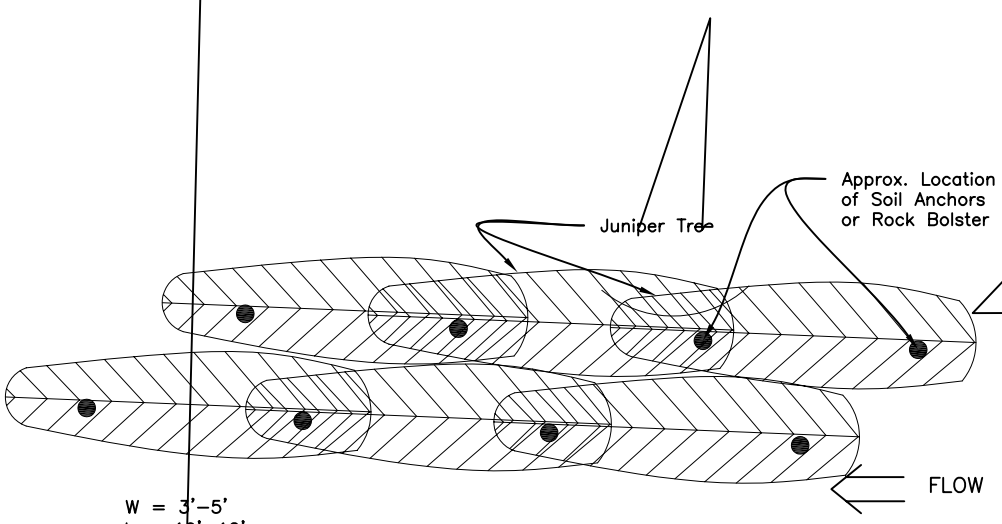

Lations. Start at toe of bank.
If additional rows are required, offset by not more than tree width. Press rows tight together. Cable rows together with 12 gage wire or ⅛" cable and clamp.

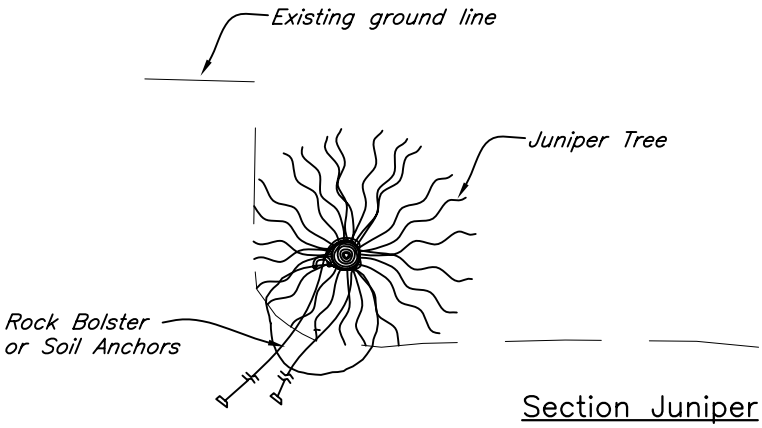

Section Juniper
N.T.S

f ⅛–¼" diameter galvanized non–greased, wire rope. If constructing in or near water drill holes in rock bolsters with gas or pneumatic drill. The min. depth should be 6 inches. Holes must be clean of all dust, debris, oil, and soap following drilling. Insert a U–shaped rebar or eyebolt into holes several times to dispense and completely mix epoxy and eliminate air pockets. Epoxy resin systems shall meet the requirements of ASTM C881, Type IV Grade 3. Test strength of bond after minumum cure time recommended by the epoxy manaufacturer.

Conceptual Plan - Not f

NRCS
Natural Resources Conservation Service
United States Department of Agriculture

Designed	08/05
Drawn	08/05
Checked	
Approved	